DOMCom PC Installation Instructions

John Jacobsen jacobsen@rust.lbl.gov



Lawrence Berkeley National Laboratory

Version 1.7 November 13, 2001

This document describes the configuration of the six DOMCom PCs used in the DAQ for AMANDA's String 18 at the South Pole. Five DOMCom PCs are to be deployed at Pole, and one is to remain at LBNL for testing. These PCs each contain 8 DOMCom boards. The DOMCom boards enable communications with the string of Digital Optical Modules (DOMs) deployed in the ice at the South Pole.

Look for updated versions of this document at

 $\label{local_problem} $$ $ \begin{array}{ll} \text{http://rust.lbl.gov/~jacobsen/docs/installation_of_domcom_machines.pdf} \\ \text{http://rust.lbl.gov/~jacobsen/docs/installation_of_domcom_machines.doc} \\ \end{array} $$ $$ \begin{array}{ll} \text{http://rust.lbl.gov/~jacobsen/docs/installation_of_domcom_machines.doc} \\ \end{array} $$ $$ \begin{array}{ll} \text{http://rust.lbl.gov/~jacobsen/docs/installation_of_domcom_machines.doc} \\ \end{array} $$ \begin{array}{ll} \text{http://rust.lbl.gov/~jacobsen/docs/installation_of_docs/installation_of_docs/installation_of_docs/in$

Table of Contents

1
. 1
. 1
. 2
. 2
. 3
. 4
. 6

Hardware Preparation

Rearrange hardware inside:

Make 8 contiguous ISA slots (move parallel connector to PCI area).

Cable IDE hard disk to primary IDE controller; cable CD-ROM drive to secondary. Make sure both are jumpered as master devices.

We replaced the passive backplanes on most and power supplies on all five units destined for Pole.

Important: Before installing in the rack, open the cover of the PCs and verify that no cables are blocking any fans from turning.

When cover is closed, power on. Hit "Del" key right away to change the BIOS settings.

BIOS Settings

BIOS Update 1: Free IRQ 10 in BIOS by setting its IRQ handling to be "Legacy ISA" rather than ISA/PnP:

Select PNP/PCI CONFIGURATION

Set "Resources Controlled by:" to Manual

Set "IRQ 10 Controlled by" to "Legacy ISA"

We will need IRQ 10 for the DOMCOM Device Driver (tb).

BIOS Update 2: Change BIOS to boot from CD:

Select BIOS FEATURES SETUP

Select Boot Sequence

Select CDROM,C,A

BIOS Update 3: In "Integrated Peripherals," make sure

Serial1 is 3F8/IRO4

Serial2 is 2F8/IRQ3

Also make sure IR port is disabled (just below serial settings in the same menu)

Exit and save BIOS settings.

See the Appendix on BIOS Settings for screen shots of a working machine.

Linux Installation

Boot RedHat 7.1 install disk.

Select default option by typing return

(If blue screen appears with no further change in > 60 seconds, hit the reset button and try again)

Choose defaults until you get to the "Install Options" screen.

Then choose "custom system" installation.

Partition manually with Disk Druid

Delete existing DOS partition

Add the following partitions:

/boot 38 MB Linux native / 6000 MB Linux native swap 256 MB Linux swap

1024 MB FAT (for DOS) (leave mount point blank)

/home (use remaining) Linux native

Click on Next. Select all available partitions to format. Check "check for bad blocks". Click on Next.

LILO configuration: use defaults

Network configuration: use defaults (DHCP)

Firewall: choose no firewall

Timezone info – I chose California, but this should probably be UTC eventually.

Set root password. Create DOM account with user dom.

Authentication – choose defaults

Package installation – choose the following:

Printers

X-Windows

Gnome

Mail/WWW/News

DOS/Windows connectivity

Networked workstation

Dialup workstation (for minicom)

Anonymous FTP

Emacs

Development

Kernel development

Utilities

X-Configuration: choose defaults for the screens, however in the "Custom Configuration," select "text login" rather than "Graphical."

Click next twice and wait for awhile while software packages are installed. You'll have to change CDs once.

Linux Configuration

Let the system reboot.

Log in as dom.

Run /sbin/ifconfig. Read the Hwaddr field. It should be something like "00:E0:4C:51:00:A3".

This is the MAC address. Write it on the front panel. Also see below for the MAC addresses.

Change shell to tesh using the program chsh.

Scp .cshrc from another installed host to dom account.

Scp .bashrc from another installed host to root account.

Log out and log in again (to activate new shell) or type "/bin/tcsh"

Disable unneeded and possibly insecure services:

Sendmail, portmap, nfslock:

S11

/sbin/chkconfig --level 012345 sendmail off

/sbin/chkconfig --level 012345 portmap off

/sbin/chkconfig --level 012345 nfslock off

DOMCom Driver Software Installation

Set up the FPGA area in the DOM account (used to store working versions)

su dom

mkdir /home/dom/fpga

scp the FPGA designs from another machine to this directory

Set up the software release directories:

SII

mkdir /usr/local/dom

```
chown dom /usr/local/dom.
        su dom
        cd /usr/local/dom
         mkdir bin lib driver fpga
        mkdir bin/backup lib/backup
Get the driver, syncserver software, etc.:
        Change back to the dom home directory with "cd"
        cvs checkout domsoft
Build the driver:
        su dom
        Change to the driver directory: "cd ~/domsoft/src/driver"
        su, then make install
Build syncserver, dataserver:
        su dom
        Change to the portio directory: "cd ~/domsoft/src/portio"
        make
        make install
Make sure tbrc (the startup script for syncserver, dataserver and the driver) is in /etc/rc.d/init.d:
        /sbin/chkconfig --list | grep tbrc
         Assuming it's there, turn it on for the normal runlevels:
        /sbin/chkconfig --level 345 tbrc on
Create the device files /dev/tb*:
        mknod /dev/tb0 c 88 0
        mknod/dev/tb1 c 88 1
        mknod /dev/tb2 c 88 2
        mknod /dev/tb3 c 88 3
        mknod /dev/tb4 c 88 4
        mknod /dev/tb5 c 88 5
        mknod /dev/tb6 c 88 6
        mknod/dev/tb7 c 88 7
        chmod 0666 /dev/tb*
Reboot; log in as dom; su; watch the system log with tail -f/var/log/messages; connect using domtalk
from outside, see if test board driver (tb), syncserver and dataserver show up in the system log.
Additional software installation
Installation of minicom: copy minicom-1.83.1-8.i386.rpm from Jacobsen's account on rust.
        rpm -ivh minicom-1.83.1-8.i386.rpm
```

Run it as root, create initialization file: minicom -s com1

Enter serial port setup

Change as follows:

Serial device -> /dev/ttyS0 Lockfile -> /var/lockS0 Hardware flow control -> no chmod o+rw /dev/ttyS0 chmod o+rw /dev/ttyS1

Current Status

Hardware swapped in all machines for Pole.

Machine	new backplane	new psupp	gps works	domcom works
Tbdaq-1	yes	yes	yes	yes
Tbdaq-2		yes	yes	yes
Tbdaq-3		yes	yes	yes
Tbdaq-4		yes	yes	yes
Tbdaq-5	yes	yes	yes	yes
Tbdaq-6	swapped to old type	no	yes	yes

Earlier notes:

Tbdaq-1 is loaded. Driver, dataserver and syncserver are loaded. System is ready to test w/ DOMCom boards. Tbdaq-1 has "DMA Interrupt Errors" associated with the hard disk. They seem to not actually cause any problems. We swapped CPUs, CDs and hard disks with another unit which did not seem to fix the problem. The errors don't seem to affect anything, so we are shipping the unit as is.

Tbdaq-2 seems flaky. System crashed twice during install. After changing the host name in the network setup, gnome crashed and now it doesn't even boot at all.

Try reinstall. Tried many things. Basically nothing worked with this CPU board. Installed ok using board from system 2.

Reinstalled using CPU 6. CPU 6 is now CPU 2. MAC and IP addresses below updated. System 2 looks ok.

Tbdaq-3 – install going ok. Nuke install during testing of other flaky units. Reinstall ok. Driver software up to date as of 10/17/01.

Tbdaq-4 – when selecting partitioning method, setup crashes and tells me it's ok to reboot the system. Recabled system so that CD and disk are both master on their own IDE bus. Disk gets primary, CD gets secondary. Installation proceeds ok at that point. Software installed and up to date as of 10/17/01.

Tbdaq-5 - no problems.

Tbdaq-6 – had trouble with CD media during install. Cleaned CD. Seemed ok. Still should cable 2nd IDE bus. First or second startx froze. Startx worked after that. Will watch. Swapped CPU out into 2. Will wait for new CPU. Install on disk should be ok.

11/9/01 got new CPU in there – works like a charm.

MAC addresses:

tbdaq-1 MAC address: 00:E0:4C:56:00:1F tbdaq-2 MAC address: 00:E0:4C:55:00:20 tbdaq-3 MAC address: 00:E0:4C:51:00:A3 tbdaq-4 MAC address: 00:E0:4C:56:00:20 tbdaq-5 MAC address: 00:E0:4C:51:00:67

These are fixed by the hardware.

Appendix - BIOS Settings

These were taken from tbdaq-6, which is the DOMCOM PC which is staying at LBNL.

Version information


```
Award Modular BIOS v4.51PG, An Energy Star Ally Copyright (C) 1984-2000, Award Software, Inc.
```

A-675 VER:1.1

Changeable BIOS Settings (not in order)

This is the most important screen - you have to change the setting for IRQ 10 in order for the device driver to work:

```
ROM PCI/ISA BIOS (2A5IMTPK)
                          PNP/PCI CONFIGURATION
                           AHARD SOFTHARE, INC.
Resources Controlled By : Manual
                                       PCI IRQ Actived Bu
                                                               : Level
Reset Configuration Data : Disabled
IRQ-3 assigned to : PCI/ISA PnP
IRQ-4 assigned to : PCI/ISA PnP
IRQ-5 assigned to : PCI/ISA PnP
IRQ-7 assigned to : PCI/ISA PnP
IRQ-9 assigned to : PCI/ISA PnP
IRQ-10 assigned to : Legacy ISA
IRQ-11 assigned to : PCI/ISA PnP
IRQ-12 assigned to : PCI/ISA PnP
IRQ-14 assigned to : PCI/ISA PnP
IRQ-15 assigned to : PCI/ISA PnP
DMA-0 assigned to : PCI/ISA PnP
DMA-1 assigned to : PCI/ISA PnP
                                       ESC : Quit
                                                         ↑↓++ : Select Item
DMA-3 assigned to : PCI/ISA PnP
DMA-5 assigned to : PCI/ISA PnP
                                       F1 : Help
                                                         PU/PD/+/- : Modify
                                       F5 : Old Values (Shift)F2 : Color
DMA-6 assigned to : PCI/ISA PnP
                                       F6 : Load BIOS Defaults
DMA-7 assigned to : PCI/ISA PnP
                                       F7 : Load Setup Defaults
```

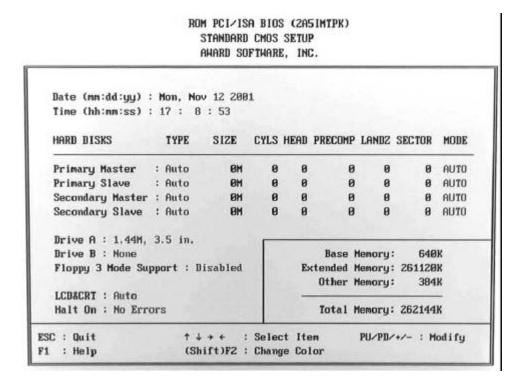

Changing the "Boot Sequence" setting as shown below allows one to boot from CD-ROM during installation or upgrade of the operating system.

```
ROM PCI/ISA BIOS (2A5IMTPK)
                           BIOS FEATURES SETUP
                           AHARD SOFTHARE, INC.
Virus Harning
                                       Video BIOS Shadow : Enabled
                          : Disabled
CPU Internal Cache
                          : Enabled
                                       C8000-CBFFF Shadow : Disabled
External Cache
                          : Enabled
                                       CC000-CFFFF Shadow : Disabled
Quick Power On Self Test : Enabled
                                       D0000-D3FFF Shadow : Bisabled
Boot Sequence
                          : CDROM.C.A
                                       D4000-D7FFF Shadow : Disabled
                        : Disabled
Swap Floppy Drive
                                       D8000-DBFFF Shadow : Disabled
Boot Up Floppy Seek : Enabled
Boot Up NumLock Status : Off
Boot Up NumLock Status : Disabled
                                       DC000-DFFFF Shadow : Disabled
                                       Cyrix 6x86/MII CPUID: Enabled
Typematic Rate Setting : Disabled
Typematic Rate (Chars/Sec) : 6
Typematic Delay (Msec)
                       : 250
Security Option
                         : Setup
                      : Disabled
PCI/UGA Palette Snoop
Assign IRQ For VGA
                          : Enabled
OS Select For DRAM > 64MB : Non-OSZ
                                       ESC : Quit
                                                        ↑↓++ : Select Item
Report No FDD For WIN 95 : Yes
                                       F1 : Help
                                                        PU/PD/+/- : Modify
                                       F5
                                           : Old Values (Shift)F2 : Color
                                       F6 : Load BIOS Defaults
                                       F7 : Load Setup Defaults
```

ROM PCI/ISA BIOS (2A5IMTPK) CHIPSET FEATURES SETUP AMARD SOFTMARE, INC.

Refresh Rate Control : 15.6us Video BIOS Cacheable : Bisabled Ref/Act Command Delay : 6T Memory Hole at 15M-16M : Disabled Refresh Queue Depth : 12 PCI Post Write Buffer : Disabled RAS Precharge Time : 3T PCI Delayed Transaction : Bisabled RAS to CAS Delay : 3T ISA Bus Clock Frequency : PCICLK/4 Starting Point of Paging: 1T L2 Cache Burst RD Cycle : Delay 1 T Asyn/Sync Mode CPU/DRAM : Asynchronous SDRAM CAS Latency : 3T SDRAM WR Retire Rate : X-Z-Z-Z DRAM Opt RAS Precharge : Disabled PCI Peer Concurrency : Disabled Read Prefetch Memory RD : Enabled Assert TRDY After Prefet: 2 QHs ESC : Quit ↑↓>+ : Select Item CPU to PCI Burst Mem. UR: Disabled F1 : Help PU/PD/+/- : Modify CPU to PCI Post Write : Disabled F5 : Old Values (Shift)F2 : Color F6 : Load BIOS Defaults AGP Aperture Size : 64MB System BIOS Cacheable : Disabled F? : Load Setup Defaults

CPU FEATURES SETUP AWARD SOFTWARE, INC.

Some of the machines were shipped with power management settings which would cause the machines to go into standby mode after four hours. The following settings should remove this possibility:

ROM PCI/ISA BIOS (2ASIMTPK)
POWER MANAGEMENT SETUP
AWARD SOFTWARE, INC.

: Bisabled ACPI function VGA Activity : Enabled Power Management : User Define IRQ [3-7,9-15],NMI : Enabled Video Off Option : Susp, Stby -> Off IRQ 8 Break Suspend : Disabled Video Off Method : U/H SYNC+Blank Switch Function : Break/Wake Doze Speed (div by): 2/8 Stdby Speed(div by): 1/8 MODEM Use IRQ : 3 Hot Key Function As: Power Off ** PM Timers ** HDD Off After : 15 Min Doze Mode : Disable Standby Mode : Disable : Disable Suspend Hode ** PM Events ** ESC : Quit ↑↓++ : Select Item HDD Ports Activity : Enabled F1 : Help PU/PD/+/- : Modifu COM Ports Activity : Enabled F5 : Old Values (Shift)F2 : Color LPT Ports Activity : Enabled F6 : Load BIOS Defaults F7 : Load Setup Defaults

ROM PCI/ISA BIOS (2ASIMTPK) INTEGRATED PERIPHERALS AWARD SOFTWARE, INC.

Internal PCI/IDE : Both Onboard Parallel Port : 378/IRQ7 IDE Primary Master PIO : Mode Ø Parallel Port Mode : SPP IDE Primary Slave PIO : Mode 0 IDE Secondary Master P10: Mode 8 PS/2 mouse function : Enabled IDE Secondary Slave PlO: Mode 8 USB Controller : Enabled Prinary Master UltraDMA: Disabled USB Keyboard Support : Disabled Primary Slave UltraDMA: Disabled Init Display First : PCI Slot Secondary MasterUltraDMA: Disabled Secondary Slave UltraDMA: Disabled IDE Burst Mode : Disabled LCD Panel Type : Panel 0 IDE Data Port Post Hrite: Disabled IDE HDD Block Mode : Disabled ACPI Disable Method : Disabled Onboard FDC Controller : Enabled Onboard Serial Port 1 : 3F8/IR04 ESC : Quit ↑↓→+ : Select Item Onboard Serial Port 2 : 2F8/IR03 F1 : Help PU/PD/+/- : Modifu IR Address Select : Disable F5 : Old Values (Shift)F2 : Color F6 : Load BIOS Defaults F7 : Load Setup Defaults